



**SERVICE BULLETIN NUMBER 0088**

**ISSUE 1**

**PAGE 1 OF 1**

**TITLE**                      **Inspection of Q2 trim bridle cables**

**CLASSIFICATION**        **Advisory**

**COMPLIANCE** **Within next 25 hours**

**APPLICABILITY**         **All Pegasus Q2 wings**

**INTRODUCTION**

An outer trim bridle cable on a Q2 wing broke in flight at 350 hours. It was obviously well frayed before failure. Fraying may happen more quickly on later wings fitted with two trim bridles. The effect of trim bridle breakage is to put the wing into the fast trim setting.

The area is very easy to inspect and attention is drawn to the owners manual as described below.

**ACTION**

Inspect the trim bridle cables every 25 hours as advised in the Quasar II (section 11.5.3.4) and Quantum 15 (section 5.3.4) manuals, paying particular attention to the pulley area. Replace broken or frayed (any strands broken) cables.

**ISSUED BY**

**DATE**